

Order No.: DD+DIS224.01E



1 piece UQHFA MA1

**ADC Solo**

Type 5155/100

**Path Speed CR SP 1001**

Type 5155/200

| Rating             |             |                 | When?       |                 |                |
|--------------------|-------------|-----------------|-------------|-----------------|----------------|
| safety<br>relevant | reliability | new<br>function | immediately | next<br>service | as<br>required |
|                    | <b>X</b>    |                 |             |                 | <b>X</b>       |

Please file this document in section 13 of your technical documentation

## **New designed Energy Chain of Cassette Unit introduced**

### **1 Symptom**

In cases of often occurring problems with the cassette unit related to the I/O-Bus, it is recommended to replace the energy chain by the new one.

### **2 Defect**

The energy chain is defective. Contact problems occur while the cassette is moved to the alignment.

### **3 Solution**

Replace the energy chain of the cassette unit by the new one:

#### **3.1 Order Number**

Energy chain module for cassette unit: **CM+9.5155.9200.0**

### 3.2

#### Scope of Delivery

- 1 x energy chain for cassette unit
- 5 x screws
- 1 x cable
- 1 x pipe clamp
- 6 x cable ties
- 1 x floppy
- 1 x documentation

### 3.3

#### Position of the Unit



View from left side with opened housing